

TECHINFO DIRECTION TECHNIQUE ET MARKETING





KB655.07/EN-06/2022

KB655.07 Installation Information

Nissan: Kubistar

Renault: Clio (II, II FL, Campus Evolution), Kangoo (Extra, I et I FL), Thalia FL, Twingo

(II et II FL), Symbol - Thalia

OE Reference OE 54310-00QAA 543A00300R

IDENTIFICATION OF THE SUSPENSION BEARING KIT SNR KB655.07



Traceability: SNR AP.40016.S01

Installation Orientation Problem

• If the suspension bearing is installed backwards into the insulator, it will impede the rotation of the steering system.

INSTALLATION ORIENTATION OF SNR BEARING AP.40016.S01



Side with visible markings -> CORRECT



Side without visible markings -> WRONG


MISSING PARTS PROBLEM

All parts supplied in the kit must be fitted in the correct orientation, failure to fit all the parts supplied in kit KB655.07 will weaken the entire suspension unit

Missing or incorrectly fitted parts causes premature bearing wear, this has an impact on all of the other suspension components.



All parts supplied in kit KB655.07 must be used and correctly installed. A small amount of play between the upper shock mount and the recoil retainer is normal.

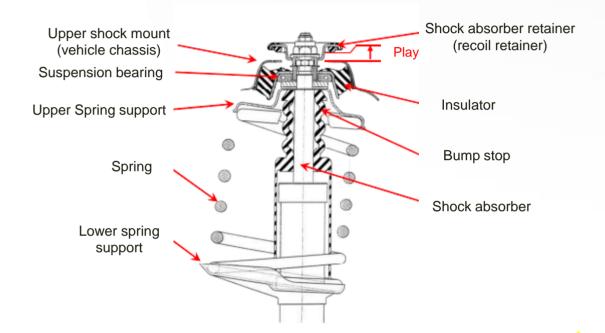

Recommendations



We recommend replacing suspension bearing kits in pairs. Refer to the vehicle applications in our online catalogue: eshop



Scan this QR code to access our online catalogue.



©NTN -SNR Roulements

The contents of this document are the copyright of the publisher and any reproduction, even partial, is prohibited without permission. Despite the care taken in preparing this document, NTN-SNR Roulements disclaims any liability for errors or omissions that may slip through, and for losses or direct or indirect damages arising from its use.





