





KB950.00/EN-06/202

KB950.00

Removal / Installation recommendations

BMW: M3 (E30, E36), Série 3 (E30,

E36, E46), Z1 (E30), Z3 (E36)

OE Reference 33521128819 33521137972

IDENTIFICATION OF SUSPENSION BEARING KIT KB950.00



COMMON PROBLEMS: THE RUBBER ISOLATOR BUSH SEPERATING FROM THE METAL **SUPPORT**

Probable cause:

Incorrect assembly of the kits components.

This failure is common when the shock absorber strut sub assembly is not correctly assembled ie, parts

fitted the wrong way around or totally missed out.



- When replacing the insulator, make sure the two mounting cups (upper and lower) are retained as they are needed to reassemble the strut top mounting.
- Make sure the cups and reinstalled the correct way around.




NTN.

KIT INSTALLATION INSTRUCTIONS



Do not change the installation orientation of the upper mounting cup (dished upwards) Do not forget to re-install the lower mounting cup in its correct installation orientation (dished downwards).

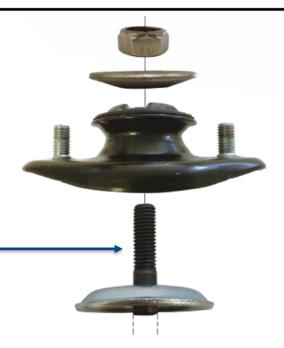

Shock absorber shaft

Recommendations

Follow the manufacturers' installation procedures and apply the tightening torques specified by the manufacturer.

Refer to the vehicle applications in our online catalogue: eshop



Scan this QR code to access our online catalogue.



©NTN-SNR Roulements

The contents of this document are the copyright of the publisher and any reproduction, even partial, is prohibited without permission. Despite the care taken in preparing this document, NTN Europe disclaims any liability for errors or omissions that may slip through, as well as for losses or direct or indirect damage arising from its use.





