



M255.04

Installation information

Dacia: Dokker, Duster, Lodgy, Logan, Sandero
Nissan: Kubistar
Renault: Clio (II, II FL, Campus Evolution), Duster, Kangoo (Extra, I et I FL), Logan, Thalia FL, Twingo (I, I FL, II et II FL), Symbol – Thalia, Lutécia, Wind

OE reference
 OE 8200651172
 54325-00QAA

IDENTIFICATION OF SUSPENSION BEARING KIT M255.04

Traceability:
SNR AP.40016.S01



COMMON PROBLEM:

KIT COMPONENTS INSTALLED IN THE INCORRECT ORIENTATION

When a suspension bearing is installed the wrong way round in the insulator, it will impede the rotation of the steering system

INSTALLATION ORIENTATION OF SNR BEARING AP.40016.S01



Side with visible markings
 => **OK**




Side without visible markings
 => **NO**



All components must be fitted in the correct order and orientation.

A small amount of play between the shock absorber mounting crown and the rebound cup is normal

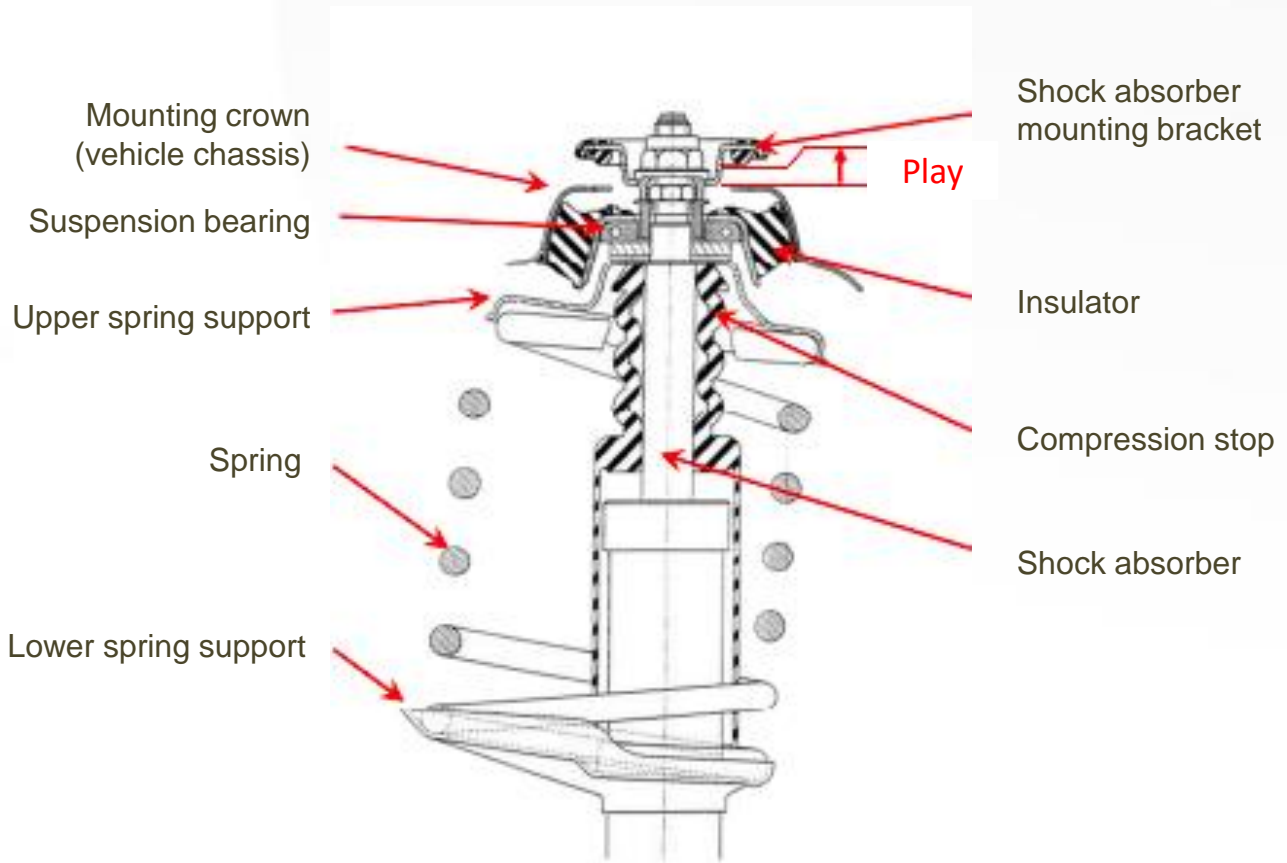

Recommendations

Follow the manufacturers' installation procedures and apply the tightening torques specified by the manufacturer.

SNR kit KB655.07 is supplied as a full kit for one side, NTN Europe recommends that both sides are changed at the same time.

Refer to the vehicle applications in our online catalogue: [eshop](#)



Scan this QR code to access our online catalogue

FOLLOW THE RECOMMENDATIONS OF THE VEHICLE MANUFACTURER !

©NTN-SNR Roulements

The contents of this document are the copyright of the publisher and any reproduction, even partial, is prohibited without permission. Despite the care taken in preparing this document, NTN-SNR Roulements disclaims any liability for errors or omissions that may slip through, as well as for losses or direct or indirect damage arising from its use.

